

STUD WELDING PRODUCTS, INC.

Procedure For Stud Welding Shear Connectors, Headed Anchors, Deformed Bar Anchors and Threaded Studs

In order to achieve optimum results in any shear connector or headed anchor weld, it is imperative that the following procedures be followed:

1. Top Flange of Beam

The top flange of all beams or plates to be welded should be free of paint, excessive rust or mill scale, dirt moisture and all other foreign material. These materials are contaminants to any welding process, but especially stud welding due to the short duration of the weld.

2. Structural Ground

It is always recommended that the welding ground be attached to a spot on a beam that has been ground clean. Poor or inadequate ground connections can result in a loss of weld current and, therefore, affect weld quality.

3. Power Requirement for Operating Power Source

Consult the power source manual or manufacturer for the recommended incoming power requirements prior to energizing the power source. This includes proper fuse selection, and primary cable size and length for the power source being used. Inadequate incoming primary power or incorrect conductor size or length can contribute to a reduction in the required weld current.

4. Welding Current

It is essential to have the correct weld current for each application. The normal ranges are listed below. When excessive cable lengths are used, the result will be a reduction in weld current. This can contribute to weld inconsistency or even weld failure. Always use 4/0 cables in the welding circuit, when excessive length is required. The amount of cable totally depends upon the power source being used. It may be necessary in some cases to parallel cable when long runs are necessary.

1/4" = 350 to 450 amps	3/4" = 1450 to 1750
3/8" = 525 to 700 amps	7/8" = 1700 to 1950 amps
1/2" = 750 to 925 amps	1" = 2000 to 2200 amps
5/8" = 1100 to 1400 amps	

5. Weld Setting

Exact weld settings cannot be given because no two jobs are the same. Actual settings will depend upon job site Conditions. Listed on the next page are approximate settings.

6. Testing of Welded Studs

At least two studs should be bent in any direction to a 30 degree angle from weld position striking with a hammer or bending with a pipe. For deformed bar anchors, bend around a pin the diameter that is equal to twice the diameter of the specimen. If a failure occurs, re-adjust settings and repeat test. Once the setup has been approved, production may be started. It is a good idea to test two or three studs every half hours to assure that the set-up has not changed. This can be accomplished by bending several studs to a 15 degree angle from weld position. If a failure does not occur, the weld should be considered good. It is not necessary to straighten a stud that is bent. Testing should be carried out at the beginning of each day, after any change in operator, or if the set-up is changed in any way.

STUD WELDING PRODUCTS, INC.

Stud Base Diameter			Welding Downhand				Welding Overhead				Welding to a Vertical Surface			
			Welding Current A	Weld Time, Seconds	Lift, in.	Plunge, in.	Welding Current A	Weld Time, Seconds	Lift, in.	Plunge, in.	Welding Current A	Weld Time, Seconds	Lift, in.	Plunge, in.
1/4	6.4	0.0491	450	.17	0.062	0.125	450	.17	0.062	0.125	450	.17	0.062	0.125
5/16	7.9	0.0767	500	.25	0.062	0.125	500	.25	0.062	0.125	500	.25	0.062	0.125
3/8	9.5	0.1105	550	.33	0.062	0.125	550	.33	0.062	0.125	600	.33	0.062	0.125
7/16	11.1	0.1503	675	.42	0.062	0.125	675	.42	0.062	0.125	750	.33	0.062	0.125
1/2	12.7	0.1964	800	.55	0.062	0.125	800	.55	0.062	0.125	875	.46	0.062	0.125
5/8	15.9	0.3068	1200	.67	0.093	0.187	1200	.67	0.062	0.187	1275	.60	0.062	0.187
3/4	19.1	0.4418	1500	.84	0.093	0.187	1500	.84	0.062	0.187	Consult SWP technical support			
7/8	22.2	0.6013	1700	1.00	0.125	0.250	1700	1.00	0.062	0.250	Consult SWP technical support			
1	25.4	0.7854	1900	1.40	0.125	0.250	2050	1.20	0.062	0.250	Consult SWP technical support			

Gun lift should be measured with a stud and ferrule in place and the gun compressed as if to weld, using an insulated piece of material, such as a piece of wood.

Weld current should also be checked by using an amp meter and should be checked periodically due to cable heating which can cause a reduction in weld current.

NOTE: For 3/4" weld thru deck application settings, consult your local Stud Welding Products Representative.

7. Visual Inspection

Visual inspection should show a full 360 degree weld fillet, although not necessarily the same fillet height around the circumference of the stud. An under cut at the weld interface will be cause for rejection. If the fillet is something less than 360 degrees complete the fillet by hand welding. The studs should then be tested by bending 15 degrees from their original axis either by striking with a hammer or placing a pipe over the stud and manually or mechanically bending the stud. If a failure does not occur, the weld should be considered good. If the weld fails, the studs should be replaced. (See AWS D1.1, Section 7.8.1)

8. General Information


- A) Keep ferrules dry; wet ferruled cannot be used
- B) Keep stud dry; rusty studs cause welding problems and premature chuck failure
- C) Do not weld when the temperature of the base material is below 0 degrees F per AWS D1.1, Section 7.5.4
- D) Do not attempt to weld through more than 2 thickness of galvanized decking
- E) Do not weld where water is present on the weld surface.
- F) Do not weld through dirt, sand or other foreign material.
- G) Beam flanges should be free of paint, rust and any other foreign material.
- H) If welding thru deck, deck must be tight against beam flange.
- I) Weld studs in the center of beam flange whenever possible to eliminate arc blow.
- J) Hold gun perpendicular to base material.
- K) Test weld set-up at the start of each day and every half hour.

9. Certification

Certification of personnel for stud welding applications is available from SWP personnel upon Request.

Gun Set-up


TOOLS REQUIRED

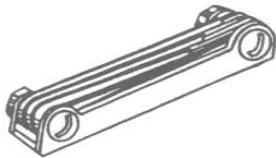

Allen Wrench
Set



Chuck
Ejector Key

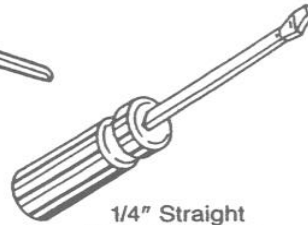

1/4" Straight
Blade Screwdriver




Small
Adjustable Wrench

SET-UPS


STANDARD

For threaded &
non-threaded studs.

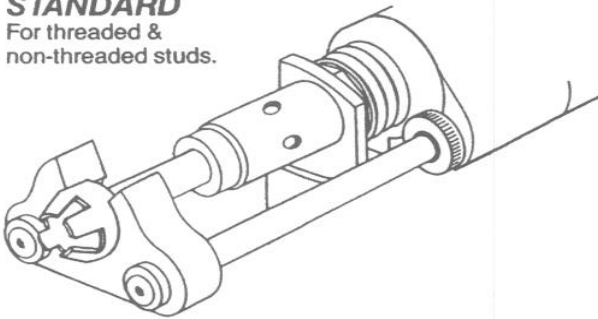


BENT STUDS

For 90° bent studs
of all types.

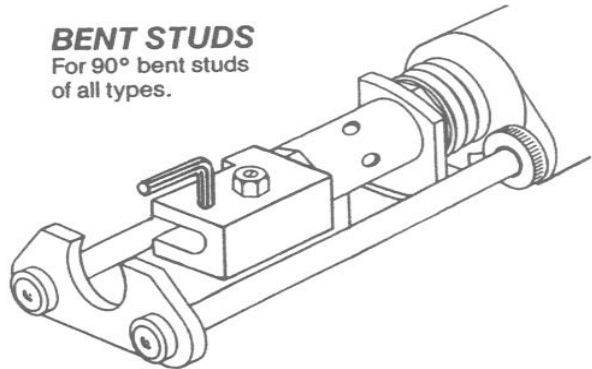


REFRACTORY ANCHOR

For bullhorn &
"Y"-refractory anchors.

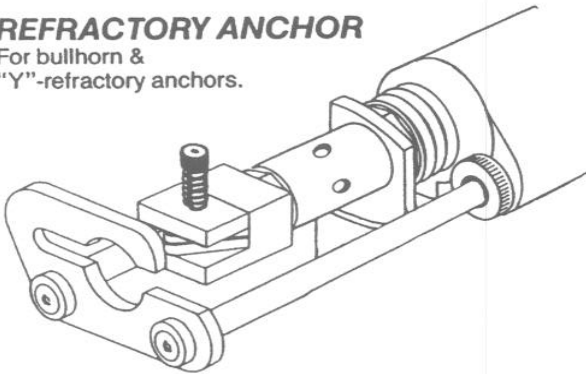

WELD THRU DECK

For welding headed anchors thru
corrugated decking.

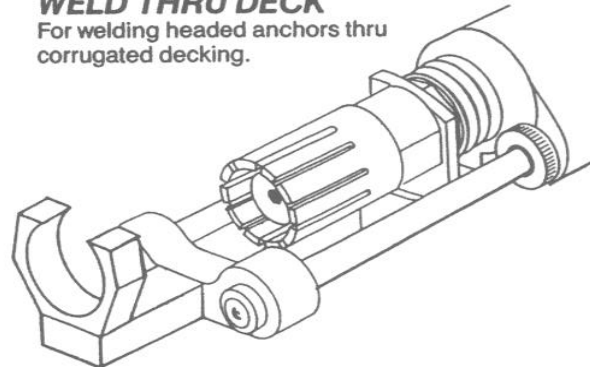

STUD WELDING PRODUCTS 1-800-252-1919

STUD WELDING PRODUCTS, INC.



STUD WELDING PRODUCTS 1-800-252-1919

APPROXIMATE STUD WELD SETTING FOR MILD AND STAINLESS
STEEL STUDS TO MILD AND STAINLESS BASE MATERIALS.

DIA- METER	DOWN HAND			OVERHEAD			VERTICAL			INSIDE ANGLE		
	WELD AMPS	SEC. TIME	CYCLE TIME	WELD AMP	SEC. TIME	CYCLE TIME	WELD AMPS	SEC. TIME	CYCLE TIME	WELD AMPS	SEC. TIME	CYCLE TIME
1/4	450	.18	11	450	.17	11	450	.17	11	490	.19	12
5/16	500	.25	15	500	.25	15	500	.25	15			
3/8	550	.33	20	550	.33	20	600	.33	20	660	.39	23
7/16	675	.41	25	675	.41	25	750	.33	20			
1/2	800	.55	33	800	.55	33	875	.47	28	900	.52	32
5/8	1200	.66	40	1200	.66	40	1275	.60	36	1320	.66	40
3/4	1500	.85	53	1500	.85	53	1700	.73	50	1750	.80	55
7/8	1700	1.05	63	1700	1.05	63	NOT RECOMMENDED			NOT RECOMMENDED		
1	1900	1.42	85	2050	1.20	72	NOT RECOMMENDED			NOT RECOMMENDED		

STUD STICK OUT PAST FERRULE (PLUNGE LENGTH)

DOWNHAND ,OVERHEAD,VERTICAL DIAMETER	SICKOUT	INSIDE ANGLE DIAMETER	STICKOUT
1/4-1/2	1/8	1/4-1/2	1/4
5/8-3/4	3/16	5/8-3/4	1/4-3/8
7/8-1	1/4		

SETTINGS ARE APPROXIMATE AND WILL VARY SLIGHTLY DUE TO SIZE AND LENGTH OF WELD
CABLE, INCOMING POWER SUPPLIED AND CONDITION OR THICKNESS OF BASE MATERIAL.


THRU-DECK 3/4

AMPS = 1600 - 2000

TIME = .08 - 1.4

STICK OUT = 3/8 - 1/2

SETTING WILL VARY DEPENDING ON
GAUGE OF DECK AND AMOUNT OF CABLE

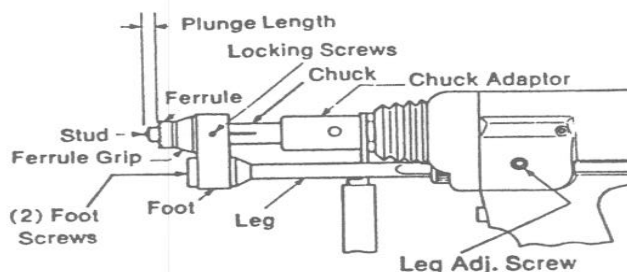

15

Check us out on the Internet www.studweldprod.com or email info@studweldprod.com

Downey, CA

9459 Washburn Rd.
Downey, CA 90242
Phone- 800.252.1919
Fax- 562.862.3022

Hayward, CA

2391 American Ave.
Hayward, CA 94545
Phone- 510.782.7883
Fax- 510.782.7918

Renton, WA

927 Thomas Ave SW
Renton WA 98057
Phone- 425.656.9787
Fax- 425.656.9786

Phoenix, AZ

3535 East Wier Ave., Ste. #4
Phoenix, AZ 85040
Phone- 602.305.9350
Fax- 602.305.4890